



JON M. HUNTSMAN, JR.
Governor
GARY R. HERBERT
Lieutenant Governor

State of Utah
DEPARTMENT OF NATURAL RESOURCES
Division of Oil, Gas & Mining

MICHAEL R. STYLER
Executive Director

JOHN R. BAZA
Division Director

Supervisor 1027

Inspection Report
Minerals Regulatory Program

Report Date: May 31, 2005

Mine Name: Unpermitted Quarry

Permit number: M/051/008

Operator or Permittee Name:

Inspection Date: May 27, 2007

West Valley Sand & Gravel, Inc.

Permittee Mailing Address:

P.O. Box 369

Heber City, Utah 84032

Inspector(s): Doug Jensen, Darron Haddock, Lynn Kunzler

Weather: Clear, Sunny

Inspection Start Time: 10:00 AM

Inspection End Time:

Other Participants: Clint Sorenson, Bret LLoyd - We3st Valley S & G.

Site location/Area Inspected (i.e. Pit #):

Quarry

Permit Status: Unpermitted

Surface Ownership: Unknown

Current Acreages:

Mineral Ownership: Unknown

Total Permitted (Bonded):

Mineral Mined: Bedrock

Total Disturbed: Unknown

Type of Mine: Quarry

Elements of Inspection	Evaluated	N/A	Comment	Enforcement
1. Permits, Revisions, Transfer, Bonds	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
2. Public Safety (open shafts, adits, trash, signs, highwalls)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
3. Protection of Drainages	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
4. Explosives, magazines	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
5. Deleterious Material	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
6. Roads (maintenance, surfacing, dust control, safety)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
7. Concurrent Reclamation	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
8. Erosion Control	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
9. Demolition	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
10. Backfilling and Grading (trenches, pits, roads, highwalls, shafts, drill holes)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
11. Water Impoundments	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
12. Soils	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
13. Revegetation	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
14. Air Quality	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
15. Facilities	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
16. Other	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

Purpose of Inspection:

This was a follow-up visit to this quarry to ascertain whether the quarry had encountered bedrock. This site had been visited several times before and bedrock material in the working face was not evident.

Inspection Summary:

Upon entering the quarry, it was evident that mining had exposed bedrock in the working face. We spoke to the quarry manager and explained to him that the portion of the quarry that would be removing this bedrock material would need to be permitted. The quarrying activity at the site is presently removing the alluvial material that is present above the bedrock. Therefore it was explained that the operation could continue. But we also told Mr. Sorenson that before any of the bedrock material could be removed the site would need to be permitted.

Mr. Sorenson explained that they presently have a permit and reclamation bond with Wasatch County. This permit requires that the final slopes be left at 2:1, soil replaced and seeded. We asked for a copy of this permit to review to check to see if the information contained would be sufficient for our permitting purposes.

Photos were taken and are enclosed with this report.

1. Permits, Revisions, Transfer, Bonds. The operator was unaware that this site would require a permit. We provided Mr. Sorenson with a web site address where he could obtain the rules and a copy of the NOI-LMO.


Directions to the site:

The site is located at the mouth of Daniels Canyon just off highway 40.

GPS data:

None gathered during this visit.

Inspector's Signature

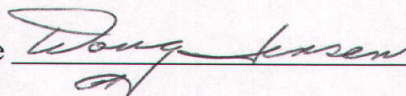

Date: May 31, 2005

DJ:jb

Enclosures: photos

cc: Clint Sorenson, Operator

O:\M051-Wasatch\M0510008-WestValley\Inspections\05272005insp.doc

